



pullman service parts catalogue

Page 2	Pullman 2 seat booth steel leg
Page 3	Pullman 2 seat booth wooden leg
Page 4	Pullman 3 seat booth steel leg
Page 5	Pullman 3 seat booth wooden leg
Page 6	Pullman service parts index
Page 7	Engineering changes



naughtone
Unit D Knaresborough Tech Park,
Knaresborough, HG5 8LF

www.naughtone.com
T: +44 1423 816500
E: sales@naughtone.com

Company reg number: 5285557

pullman

2 seat booth on steel legs

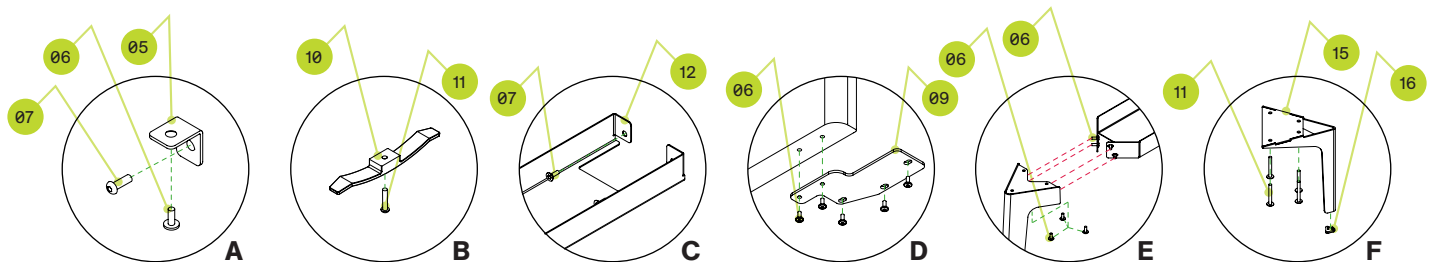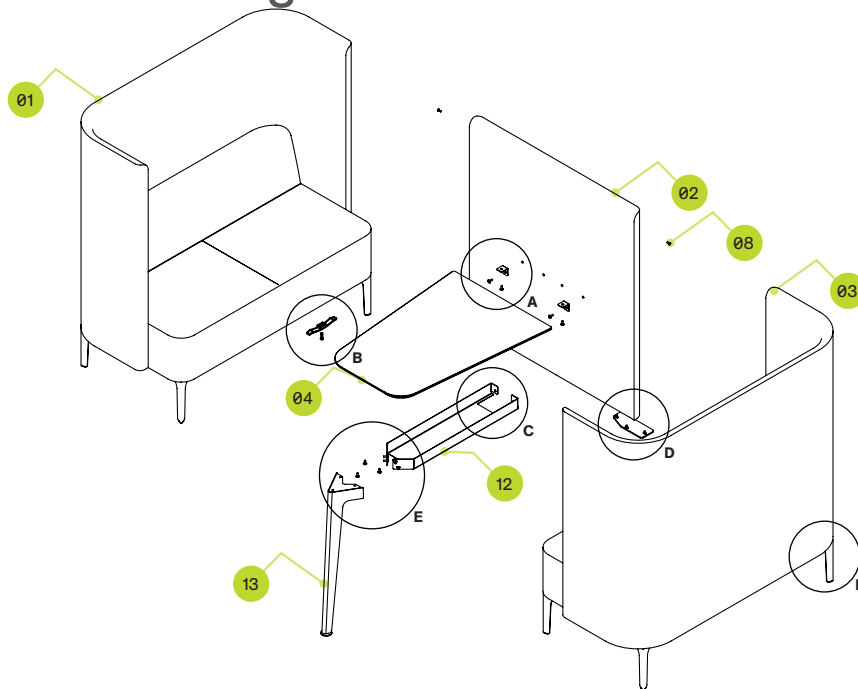

FINISHED ITEM DESCRIPTION

Pullman 2 seat booth with steel legs

FINISHED ITEM No.

PULB2HST



	COMPONENT ITEM DESCRIPTION.	COMPONENT ITEM No.	QUANTITY.
01	Pullman booth 2 seat sofa left (This part must be returned for servicing)	PULB2HSOFALEFT	1
02	Pullman booth screen (This part must be returned for servicing)	PULBSCREEN	1
03	Pullman booth 2 seat sofa right (This part must be returned for servicing)	PULB2HSOFARIGHT	1
04	Pullman 2 seat booth top (Multiple options)	Pick from index line 1-12	1
05	Pullman booth table bracket 9005 black	PULBTBLBRACKETBL	2
06	M6 X 16 TX30 flange screw	M6X16TX30FLANGE	19
07	M8 X 25 TX40 button patch screw	M8X25TXBUTPATCH	4
08	M6 X 16 TX30 CSK screw	M6X16TXCS	2
09	Pullman booth support bracket 9005 black	PULBSUPPBRACKBL	2
10	Trench 2205041 2x5 NYM3X1.5 under desk cable clip	CABLECLIP	6
11	M6 X 50 TX30 flange serrated screw	M6X50TXFLANGE	38
12	Pullman 2 seat booth fold leg table rail 9005 black	PULB2FLDTPRILBL	1
13	Fold café leg (Multiple options available)	Pick from index line 25-26	1
14	Tilt glide 110743 - 47.5 Diam M10 x 50	TILTGLIDE110743	1
15	Hatch and Symbol steel leg (Multiple options)	Pick from index line 29-30	8
16	Hatch and Symbol steel leg plastic glide REF: 1823F	HATSYMSTGLIDE	8

further information for all our products can be downloaded from the website www.naughtone.com.

ID product identification label is located here, please reference this number when you require a replacement part

CL regional compliance labels located on a swing tag or sticker here if applicable **!** see engineering changes page

2 seat booth on wooden legs

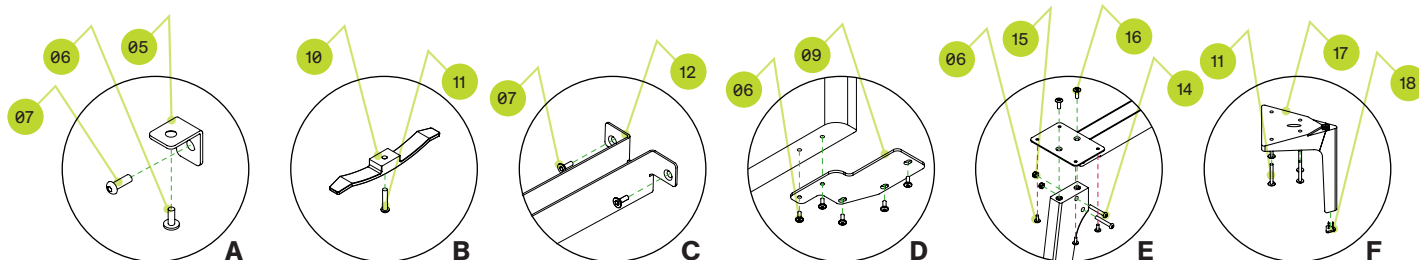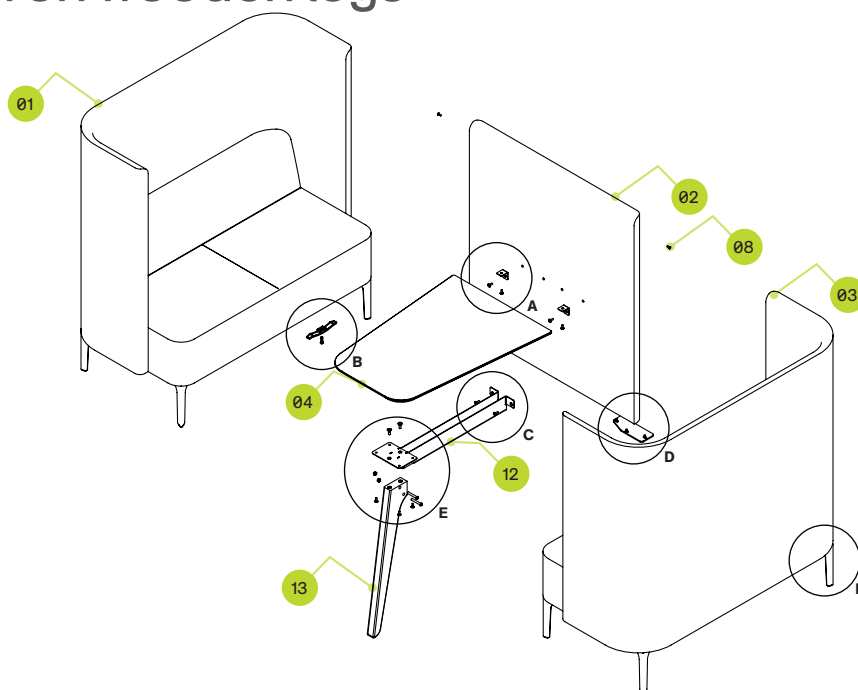

FINISHED ITEM DESCRIPTION

Pullman 2 seat booth with wooden legs

FINISHED ITEM No.

PULB2HWD

	COMPONENT ITEM DESCRIPTION.	COMPONENT ITEM No.	QUANTITY.
01	Pullman booth 2 seat sofa left (This part must be returned for servicing)	PULB2HSOFALEFT	1
02	Pullman booth screen (This part must be returned for servicing)	PULBSCREEN	1
03	Pullman booth 2 seat sofa right (This part must be returned for servicing)	PULB2HSOFARIGHT	1
04	Pullman 2 seat booth top (Multiple options)	Pick from index line 1-12	1
05	Pullman booth table bracket 9005 black	PULBTBLBRACKETBL	2
06	M6 X 16 TX30 flange screw	M6X16TX30FLANGE	16
07	M8 X 25 TX40 button patch screw	M8X25TXBUTPATCH	4
08	M6 X 16 TX30 CSK screw	M6X16TXCS	2
09	Pullman booth support bracket 9005 black	PULBSUPPBRACKBL	2
10	Trench 2205041 2x5 NYM3X1.5 under desk cable clip	CABLECLIP	6
11	M6 X 50 TX30 flange serrated screw	M6X50TXFLANGE	38
12	Pullman 2 seat booth dalby leg table rail 9005 black	PULB2DALTOPRILBL	1
13	Dalby 750 leg (Multiple options available)	Pick from index line 27-28	1
14	M8 X 55 TX40 button screw	M8X55TXBUT	2
15	M8 full hex nut stainless steel	M8NYLONNUT	2
16	M8 X 25 TX40 CSK patch screw	M8X25TXCSPATCH	2
17	Hatch and Symbol wooden leg (Multiple options)	Pick from index line 31-32	8
18	Hatch and Symbol wooden leg plastic glide	HATSYMWDGLIDE	8


further information for all our products can be downloaded from the website www.naughtone.com.

ID product identification label is located here, please reference this number when you require a replacement part

CL regional compliance labels located on a swing tag or sticker here if applicable **!** see engineering changes page

pullman

3 seat booth on steel legs

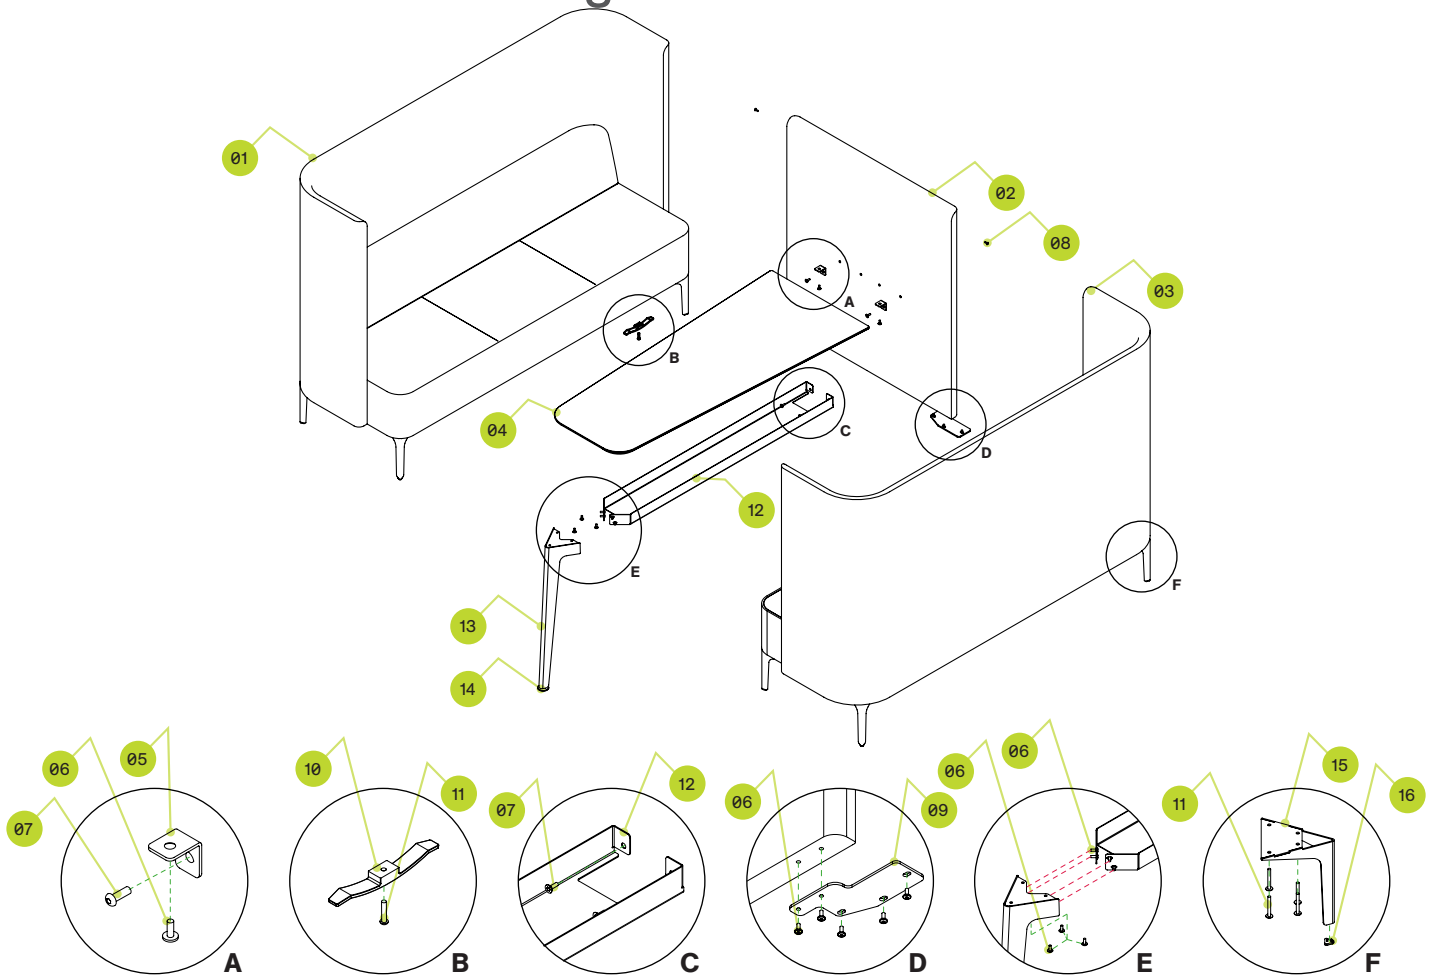

FINISHED ITEM DESCRIPTION

FINISHED ITEM No.

Pullman 3 seat booth with steel legs

PULB3HST

COMPONENT ITEM DESCRIPTION.

COMPONENT ITEM No.

QUANTITY.

01	Pullman booth 3 seat sofa left (This part must be returned for servicing)	PULB3HSOFALEFT	1
02	Pullman booth screen (This part must be returned for servicing)	PULBSCREEN	1
03	Pullman booth 3 seat sofa right (This part must be returned for servicing)	PULB3HSOFARIGHT	1
04	Pullman 3 seat booth top (Multiple options)	Pick from index line 13-24	1
05	Pullman booth table bracket 9005 black	PULBTBLBRACKETBL	2
06	M6 X 16 TX30 flange screw	M6X16TX30FLANGE	19
07	M8 X 25 TX40 button patch screw	M8X25TXBUTPATCH	4
08	M6 X 16 TX30 CSK screw	M6X16TXCS	2
09	Pullman booth support bracket 9005 black	PULBSUPPBRACKBL	2
10	Trench 2205041 2x5 NYM3X1.5 under desk cable clip	CABLECLIP	6
11	M6 X 50 TX30 flange serrated screw	M6X50TXFLANGE	38
12	Pullman 3 seat booth fold leg table rail 9005 black	PULB3FLDTPRILBL	1
13	Fold café leg (Multiple options available)	Pick from index line 25-26	1
14	Tilt glide 110743 - 47.5 Diam M10 x 50	TILTGLIDE110743	1
15	Hatch and Symbol steel leg (Multiple options)	Pick from index line 29-30	8
16	Hatch and Symbol steel leg plastic glide REF: 1823F	HATSYMSTGLIDE	8


further information for all our products can be downloaded from the website www.naughtone.com.

ID product identification label is located here, please reference this number when you require a replacement part

CL regional compliance labels located on a swing tag or sticker here if applicable  see engineering changes page

pullman

3 seat booth on wooden legs

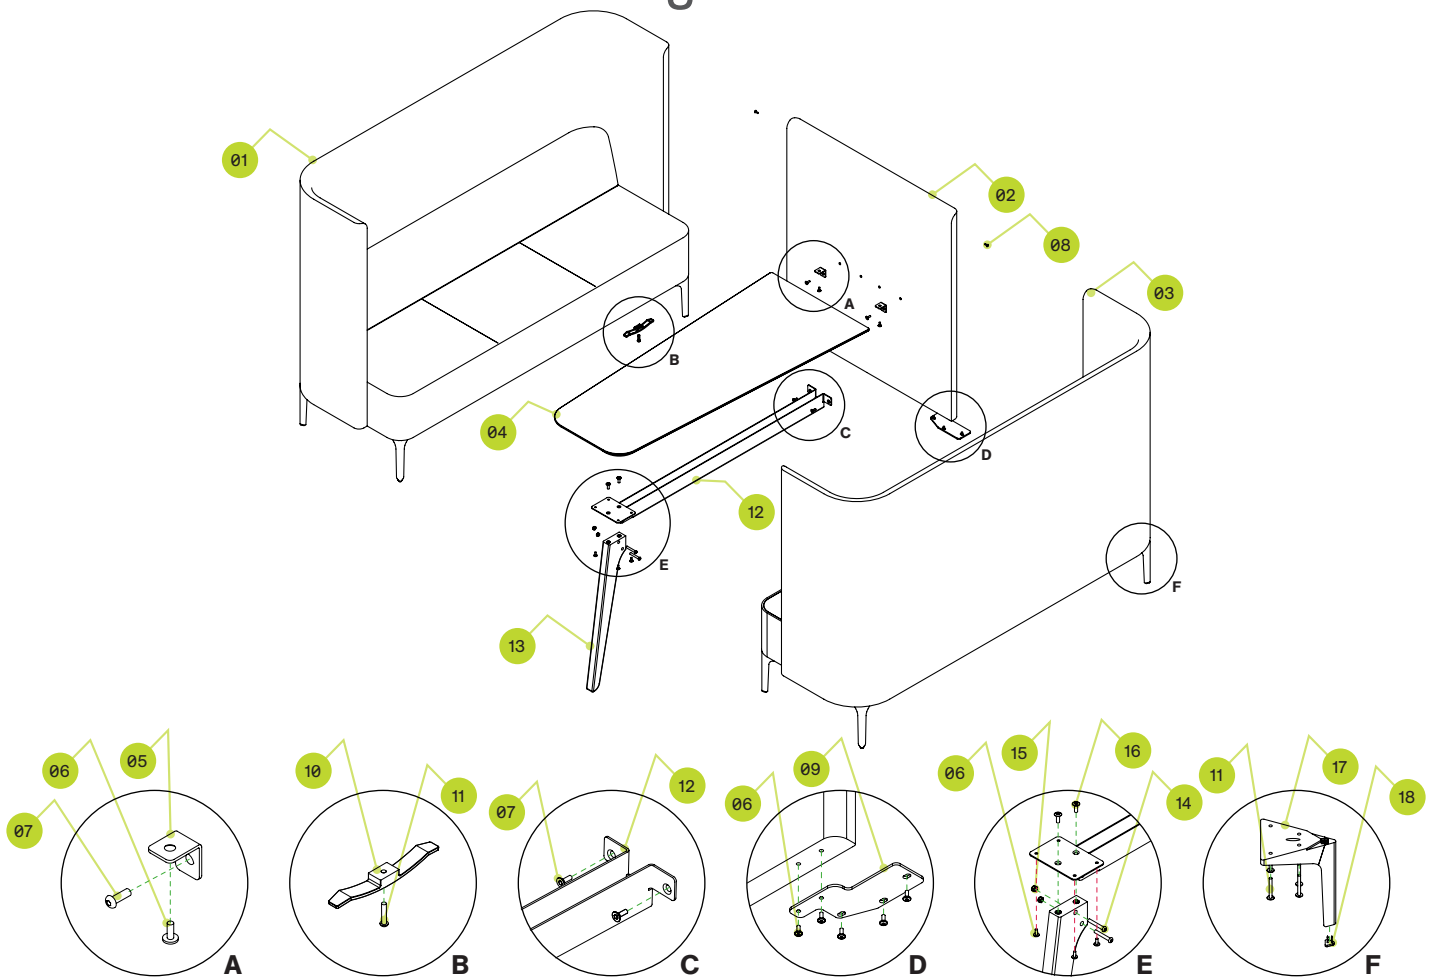

FINISHED ITEM DESCRIPTION

Pullman 3 seat booth with wooden legs

FINISHED ITEM No.

PULB3HWD

	COMPONENT ITEM DESCRIPTION.	COMPONENT ITEM No.	QUANTITY.
01	Pullman booth 3 seat sofa left (This part must be returned for servicing)	PULB3HSOFALEFT	1
02	Pullman booth screen (This part must be returned for servicing)	PULBSCREEN	1
03	Pullman booth 3 seat sofa right (This part must be returned for servicing)	PULB3HSOFARIGHT	1
04	Pullman 3 seat booth top (Multiple options)	Pick from index line 13-24	1
05	Pullman booth table bracket 9005 black	PULBTBLBRACKETBL	2
06	M6 X 16 TX30 flange screw	M6X16TX30FLANGE	16
07	M8 X 25 TX40 button patch screw	M8X25TXBUTPATCH	4
08	M6 X 16 TX30 CSK screw	M6X16TXCS	2
09	Pullman booth support bracket 9005 black	PULBSUPPBRACKBL	2
10	Trench 2205041 2x5 NYM3X1.5 under desk cable clip	CABLECLIP	6
11	M6 X 50 TX30 flange serrated screw	M6X50TXFLANGE	38
12	Pullman 3 seat booth dalby leg table rail 9005 black	PULB3DALTOPRILBL	1
13	Dalby 750 leg (Multiple options available)	Pick from index line 27-28	1
14	M8 X 55 TX40 button screw	M8X55TXBUT	2
15	M8 full hex nut stainless steel	M8NYLONNUT	2
16	M8 X 25 TX40 CSK patch screw	M8X25TXCSPATCH	2
17	Hatch and Symbol wooden leg (Multiple options)	Pick from index line 31-32	8
18	Hatch and Symbol wooden leg plastic glide	HATSYMWDGLIDE	8

further information for all our products can be downloaded from the website www.naughtone.com.

ID product identification label is located here, please reference this number when you require a replacement part

CL regional compliance labels located on a swing tag or sticker here if applicable  see engineering changes page

INDEX REF No.	COMPONENT ITEM No.	COMPONENT ITEM DESCRIPTION.
1	PULB2TOPBLMFRC	Pullman 2 seat booth top black MFMDf reverse chamfer
2	PULB2TOPWHMFRC	Pullman 2 seat booth top white MFMDf reverse chamfer
3	PULB2TOPOAKRC	Pullman 2 seat booth top oak reverse chamfer
4	PULB2TOPWALRC	Pullman 2 seat booth top walnut reverse chamfer
5	PULB2TOPLIN4176	Pullman 2 seat booth top lino 4176 mushroom reverse chamfer
6	PULB2TOPLIN4175	Pullman 2 seat booth top lino 4175 pebble reverse chamfer
7	PULB2TOPLIN4132	Pullman 2 seat booth top lino 4132 ash reverse chamfer
8	PULB2TOPLIN4155	Pullman 2 seat booth top lino 4155 pewter reverse chamfer
9	PULB2TOPLIN4166	Pullman 2 seat booth top lino 4166 charcoal reverse chamfer
10	PULB2TOPLIN4023	Pullman 2 seat booth top lino 4023 nero reverse chamfer
11	PULB2TOPLIN4179	Pullman 2 seat booth top lino 4179 smokey blue reverse chamfer
12	PULB2TOPLIN4172	Pullman 2 seat booth top lino 4172 mauve reverse chamfer
13	PULB3TOPBLMFRC	Pullman 3 seat booth top black MFMDf reverse chamfer
14	PULB3TOPWHMFRC	Pullman 3 seat booth top white MFMDf reverse chamfer
15	PULB3TOPOAKRC	Pullman 3 seat booth top oak reverse chamfer
16	PULB3TOPWALRC	Pullman 3 seat booth top walnut reverse chamfer
17	PULB3TOPLIN4176	Pullman 3 seat booth top lino 4176 mushroom reverse chamfer
18	PULB3TOPLIN4175	Pullman 3 seat booth top lino 4175 pebble reverse chamfer
19	PULB3TOPLIN4132	Pullman 3 seat booth top lino 4132 ash reverse chamfer
20	PULB3TOPLIN4155	Pullman 3 seat booth top lino 4155 pewter reverse chamfer
21	PULB3TOPLIN4166	Pullman 3 seat booth top lino 4166 charcoal reverse chamfer
22	PULB3TOPLIN4023	Pullman 3 seat booth top lino 4023 nero reverse chamfer
23	PULB3TOPLIN4179	Pullman 3 seat booth top lino 4179 smokey blue reverse chamfer
24	PULB3TOPLIN4172	Pullman 3 seat booth top lino 4172 mauve reverse chamfer
25	FLDCAFELEGBL	Fold cafe leg 9005 black
26	FLDCAFELEGWH	Fold cafe leg 9003 white
27	DAL750LEGOAK	Dalby 750 leg oak
28	DAL750LEGWAL	Dalby 750 walnut leg walnut
29	HATSYMSTEELEGBL	Hatch and Symbol steel leg black
30	HATSYMSTEELEGWH	Hatch and Symbol steel leg white
31	HATSYMWDLEGOAK	Hatch and Symbol wooden leg oak
32	HATSYMWDLEGWAL	Hatch and Symbol wooden leg walnut

engineering changes

ECO REF	FINISHED ITEMS AFFECTED	DATE CHANGED	
00052	PULB2HWD,PULB3HWD	23/07/2019	

DESCRIPTION OF ENGINEERING CHANGE	OLD Component item No.	NEW Component item No.
Change components from countersink which means change of fixing required. [PULBTBLBRACKETBL changed]	4No.M8X20TX30CSKPATCH	4No.M8X25TXBUTPATCH